SK[®] A650 (Patent Pending)


Corrects/Prevents/Reduces

Shuttle, Bind-up or Flair on 2-3 Shift, Slips with throttle in 3rd and/or 4th, TCC Codes & Rough KD at Highway Speeds due to slow TCC release.


Fits Lexus Models:

98-05 GS300 3.0L, 98-00GS400 4.0L, 01-05 GS430 4.3L 01-05 IS300 3.0L, 98-00 LS400 4.0L, 01-03 LS430 4.3L 98-00 SC400 4.0L, 01-05 SC430 4.3L



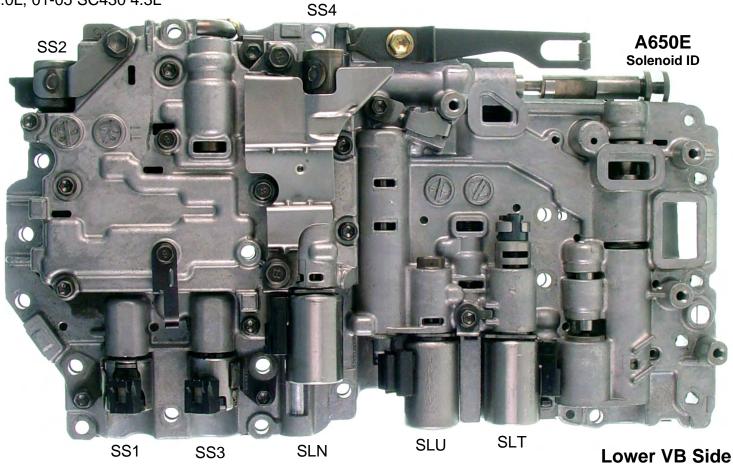



The following pages help you get it apart. The **LAST** page is the repair work. If your small part locations differ from what is shown, re-install them as found.

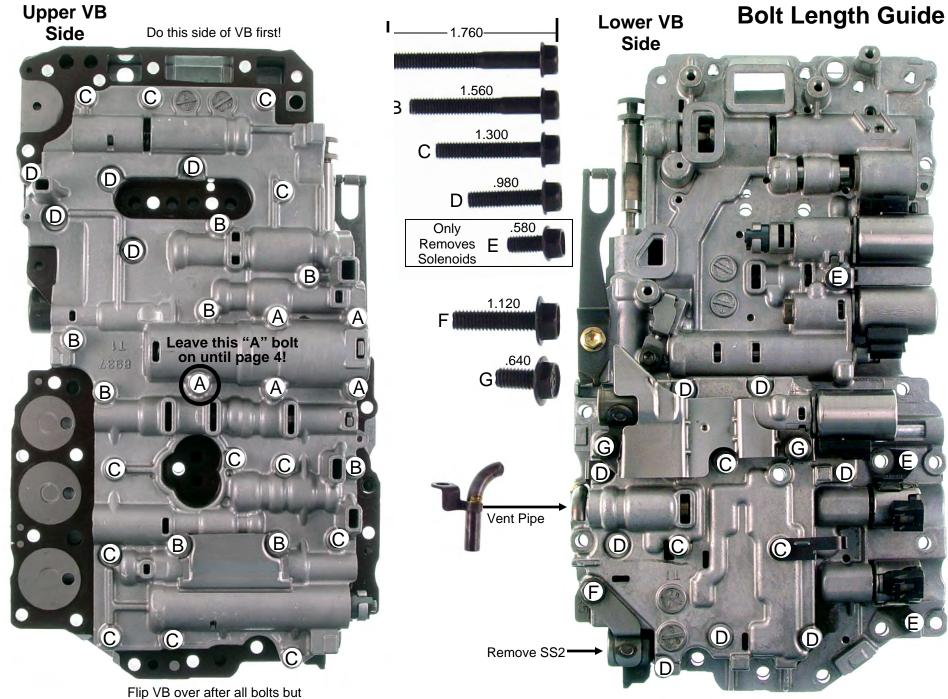


26 Feb 2019

the center "A" bolt is removed.

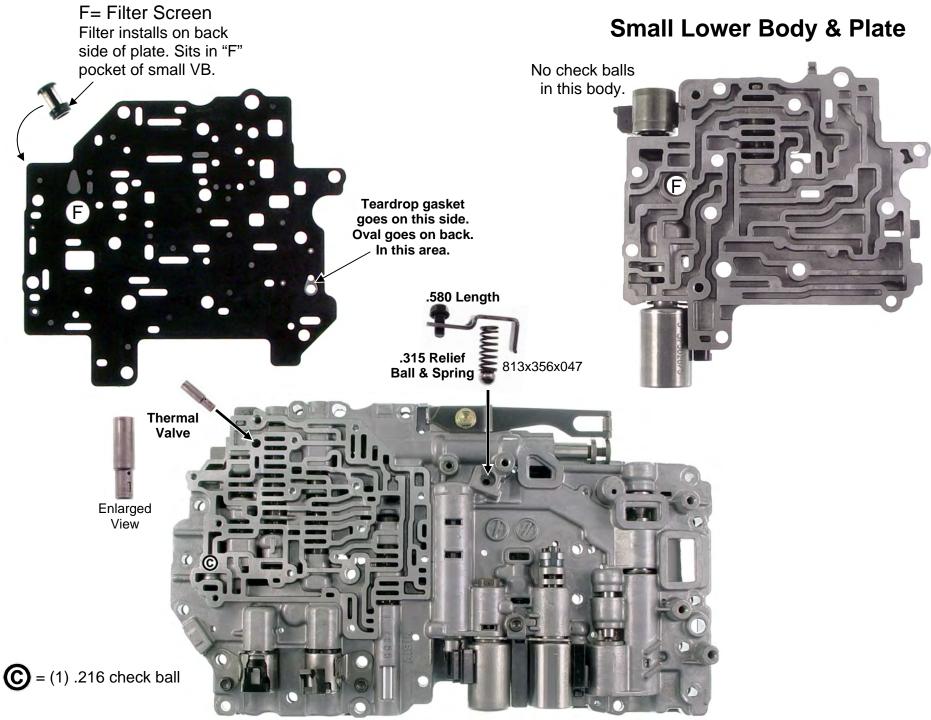

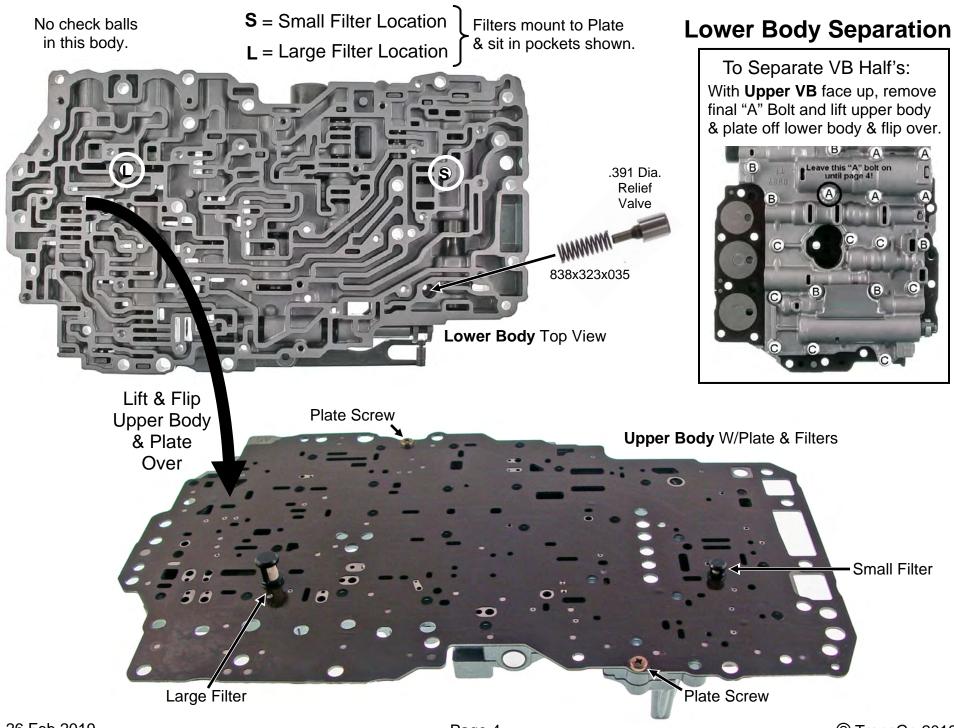


Upper Body & Plate

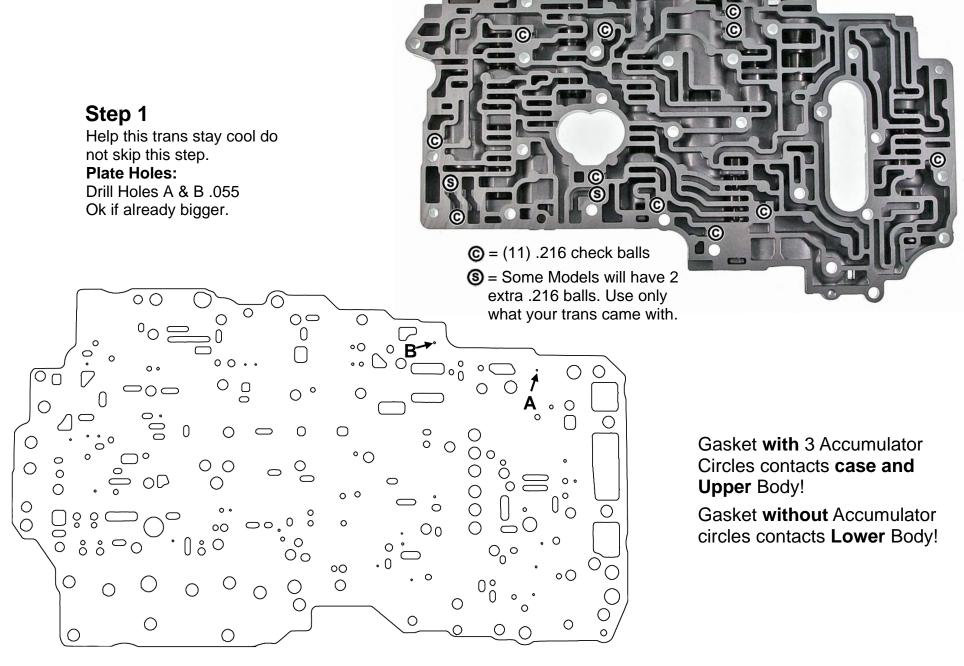

Upper Body Valve Repair

Step 1

Remove & Discard Original Sol Reg Valve, Spring & Retainer. Install New Bushing, Valve, White Spring, End Plug and New Retainer.

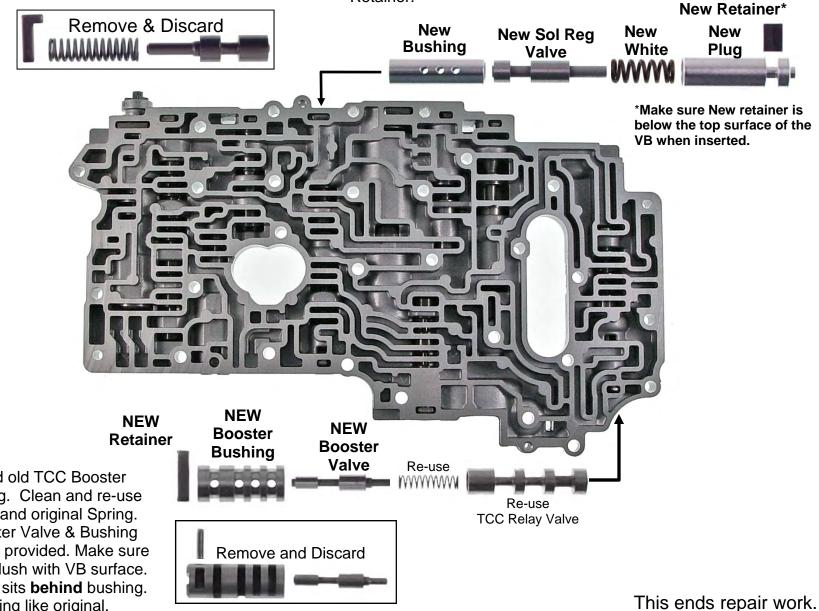

Step 2.

Remove & discard old TCC Booster Valve and Bushing. Clean and re-use TCC Relay Valve and original Spring. Install NEW Booster Valve & Bushing and NEW retainer provided. Make sure retainer is below flush with VB surface. Yes, new retainer sits **behind** bushing. Not into the bushing like original.