



# INSTALLATION GUIDE


**BAFFLED OIL CATCH CAN KIT, FITS 2021+ FORD BRONCO 2.3L  
SKU: MMBCC-BR23-21P**

## TABLE OF CONTENTS

- Pg 01** RESOURCES & CONTACT INFORMATION
- Pg 02** EXPLODED DIAGRAM  
PARTS BREAKDOWN
- Pg 03** IMPORTANT SAFETY INFORMATION  
TOOLS NEEDED  
INSTALLATION INSTRUCTIONS
- Pg 05** DISPOSAL INSTRUCTIONS  
WARRANTY INFORMATION

## RESOURCES & CONTACT

-  **CALL 1-877-GOMISHI**  
CUSTOMER SERVICE HOURS: MON-FRI 8:30AM-5:00PM EST
-  **MISHIMOTO**
-  **GOMISHIMOTO**
-  **MISHIMOTO**
-  **WEBSITE**  
[WWW.MISHIMOTO.COM](http://WWW.MISHIMOTO.COM)
-  **ENGINEERING BLOG**  
[WWW.MISHIMOTO.COM/ENGINEERING](http://WWW.MISHIMOTO.COM/ENGINEERING)

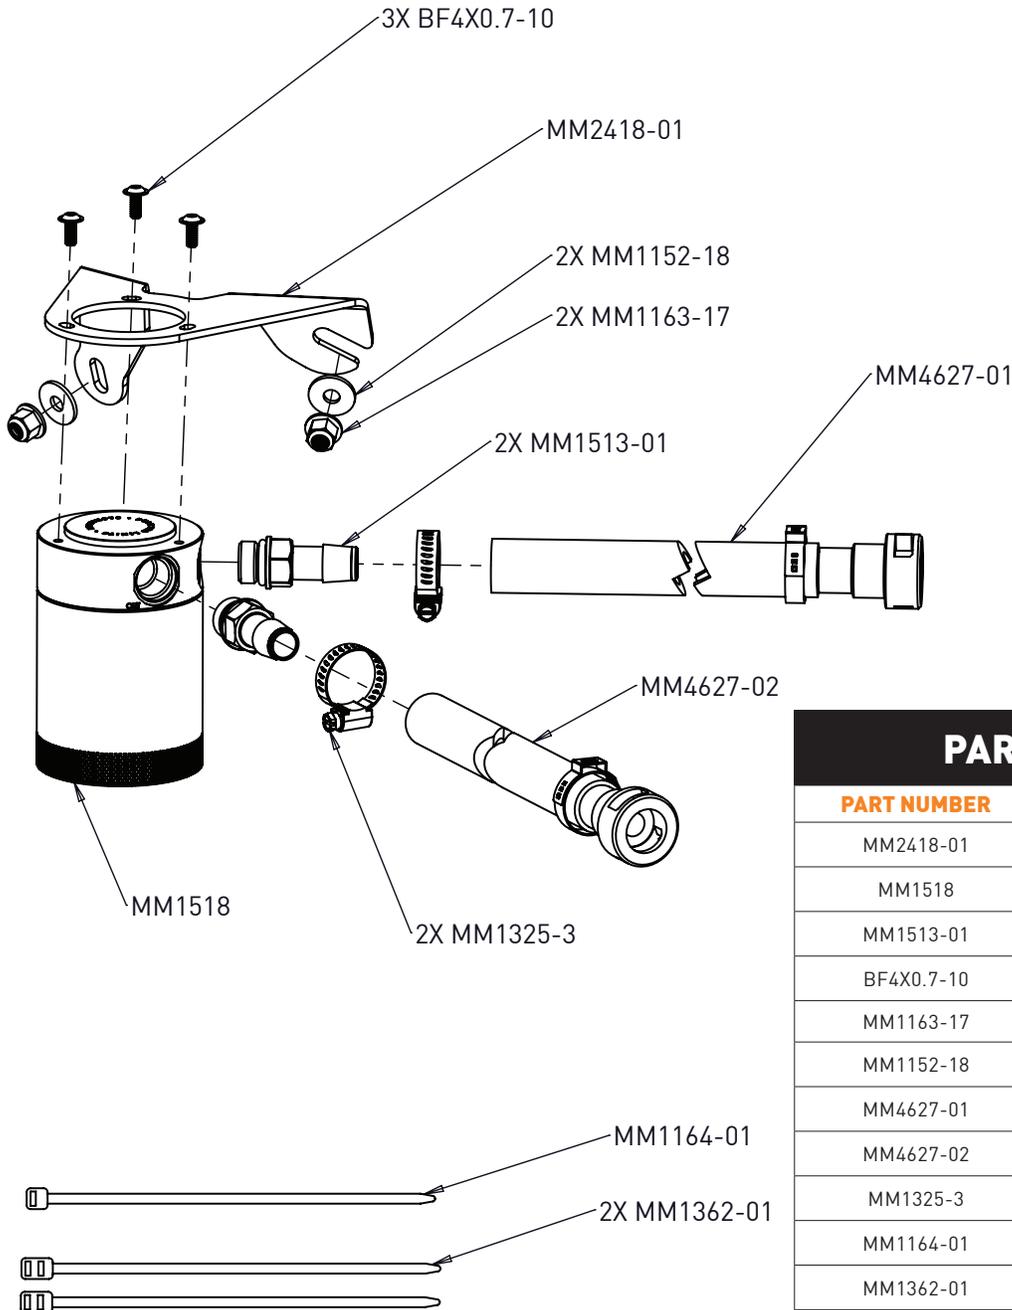

PARTS BREAKDOWN		
PART NUMBER	DESCRIPTION	QTY
MM2418-01	BRACKET	1
MM1518	2-PORT COMPACT CATCH CAN	1
MM1513-01	1/2" FITTING	2
BF4X0.7-10	M4 BUTTON HEAD FLANGED BOLT	3
MM1163-17	M6 FLANGED LOCKING NUT	2
MM1152-18	M6 FLAT WASHER	2
MM4627-01	HOSE ASSEMBLY 1	1
MM4627-02	HOSE ASSEMBLY 2	1
MM1325-3	16-25MM WORM GEAR CLAMP	2
MM1164-01	PLASTIC ZIP TIE	1
MM1362-01	DOUBLE LOOP PLASTIC ZIP TIE	2

## IMPORTANT SAFETY INFORMATION

- Mishimoto recommends you use safety glasses and protective gloves during the install of their products
- Raise vehicle only on jack stands or on a vehicle lift
- Allow vehicle to cool completely prior to attempting installation
- Do not run the engine or drive the vehicle while overheating; serious damage can occur
- Please dispose of any liquids properly
- Mishimoto is not responsible for any vehicle damage or personal injury due to installation errors, misuse, or removal of Mishimoto products
- If you need any assistance while installing our products, reach out to our Customer Service Team at 1-877-GOMISHI

## TOOLS NEEDED


- |                    |                         |
|--------------------|-------------------------|
| 1/4"-DRIVE RATCHET | 6" SOCKET EXTENSION     |
| 10MM SOCKET        | DIAGONAL CUTTING PLIERS |
| 7MM SOCKET         |                         |

## INSTALLATION INSTRUCTIONS

**01.** Locate the wiring harness mounting locations on the left side of the engine bay, to the right of the main bulkhead connectors (see detailed image in next step).



**02.** Remove one 10mm nut and cut the zip tie holding the wiring harness.

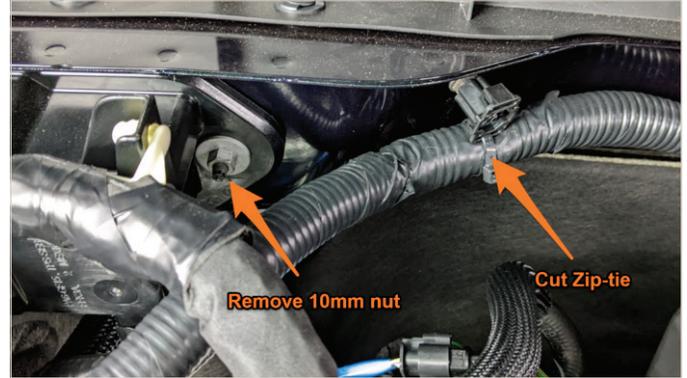

**03.** Unthread the plastic zip tie mount, this part will be reinstalled later.




**04.** Assemble catch can, fittings, and bracket as shown.



CONTINUED ON FOLLOWING PAGE

**05.** Install catch can and bracket assembly on vehicle using 2x supplied M6 nuts.

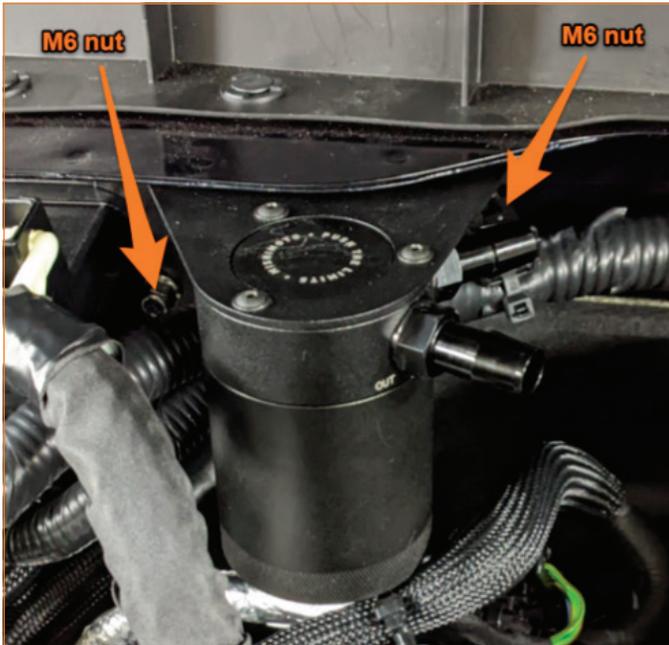


**06.** Re-install zip tie mount from step 2 and secure the wiring harness with supplied single loop zip tie.



**07.** Remove PCV line quick-disconnect fitting from the air/oil separator located on the left side of the engine block under the intake.



**08.** Remove PCV line quick-disconnect fitting the rear of the intake manifold.

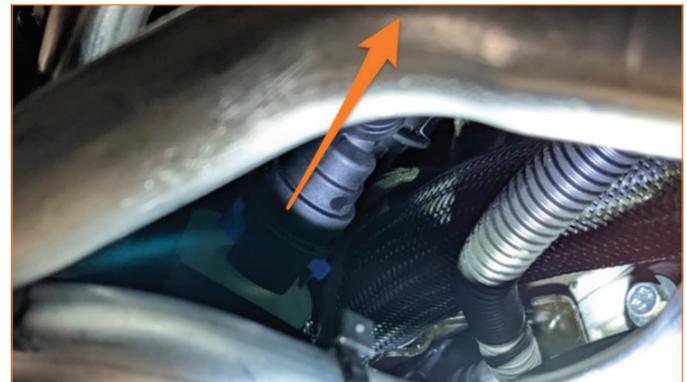

**09.** With both sides disconnected, the PCV line can be removed.



CONTINUED ON FOLLOWING PAGE

**10.** Connect the longer Mishimoto hose to the air/oil separator quick-disconnect, then to the barbed fitting on the "IN" side of the catch can. Secure line to barbed fitting with supplied worm gear clamp.

**11.** Connect shorter Mishimoto hose to the intake quick-disconnect, then to the barbed fitting on the "OUT" side of the catch can. Secure line to barbed fitting with supplied worm gear clamp.

**12.** Secure each catch can hose in place using supplied double-loop zip-ties.



**Congratulations! You have finished your installation.**

## DISPOSAL INSTRUCTIONS

- › Do not dispose of any product as unsorted municipal waste. Use separate collection facilities. Contact your local authority for information regarding the collection systems available.
- › Never improperly dispose of any coolant, oil, or other chemicals.

## WARRANTY INFORMATION



- › All claims must be accompanied with a picture of the Mishimoto product showing the issue for which the claim is being submitted.
- › Mishimoto asks that the customer inspect their purchased item for any damage immediately upon arrival.
- › Any product deemed dead on arrival

(DOA) must be claimed within

14 business days of delivery. Claims outside of this time frame will not be covered under the Mishimoto Lifetime Warranty.

- › This warranty does not include payment and/or reimbursement of the cost of labor in connection with the removal of any product returned pursuant to the warranty policy or in connection with the installation of any replacement items provided under the warranty policy.
- › Mishimoto has the right to refuse a claim at any time.
- › When Mishimoto accepts a claim, Mishimoto retains full discretion to choose if it will: (i) repair or replace purchaser's original Mishimoto product; (ii) replace purchaser's original Mishimoto product with the most current available model; or (iii) provide the purchaser with a gift card redeemable on [Mishimoto.com](https://www.mishimoto.com) in the amount of the original purchase price of the original Mishimoto product. The provision of a replacement of a Mishimoto product is subject to availability and Mishimoto retains the right to substitute any warranty claim item with a comparable item or credit at any time.

- › If Mishimoto determines that it will provide a replacement item in connection with a claim under this warranty policy, and such item is out of stock, Mishimoto will place the customer on backorder and ship the replacement product to the purchaser once it becomes available.
- › Mishimoto is not liable for incorrect shipments in connection with a claim if a claim form is completed incorrectly, or if a model number is not included in a claim.
- › If you have a vehicle equipped with an automatic transmission, please make sure to specify this within the text box on the claim form. Mishimoto is not responsible for incorrect replacement shipments if transmission type is not indicated.



**WARNING**  
Cancer and  
Reproductive Harm  
[www.P65Warnings.ca.gov](https://www.P65Warnings.ca.gov)

This product can expose you to chemicals which are known to the state of California to cause cancer. For more information visit: [www.p65warnings.ca.gov](https://www.p65warnings.ca.gov)