

15518**1994-1998 DODGE RAM LONG AND SHORT BED PICKUP WITH FACTORY BUMPER
1999-2002 DODGE RAM SHORT BED PICKUP WITH FACTORY BUMPER****8/30/2011**

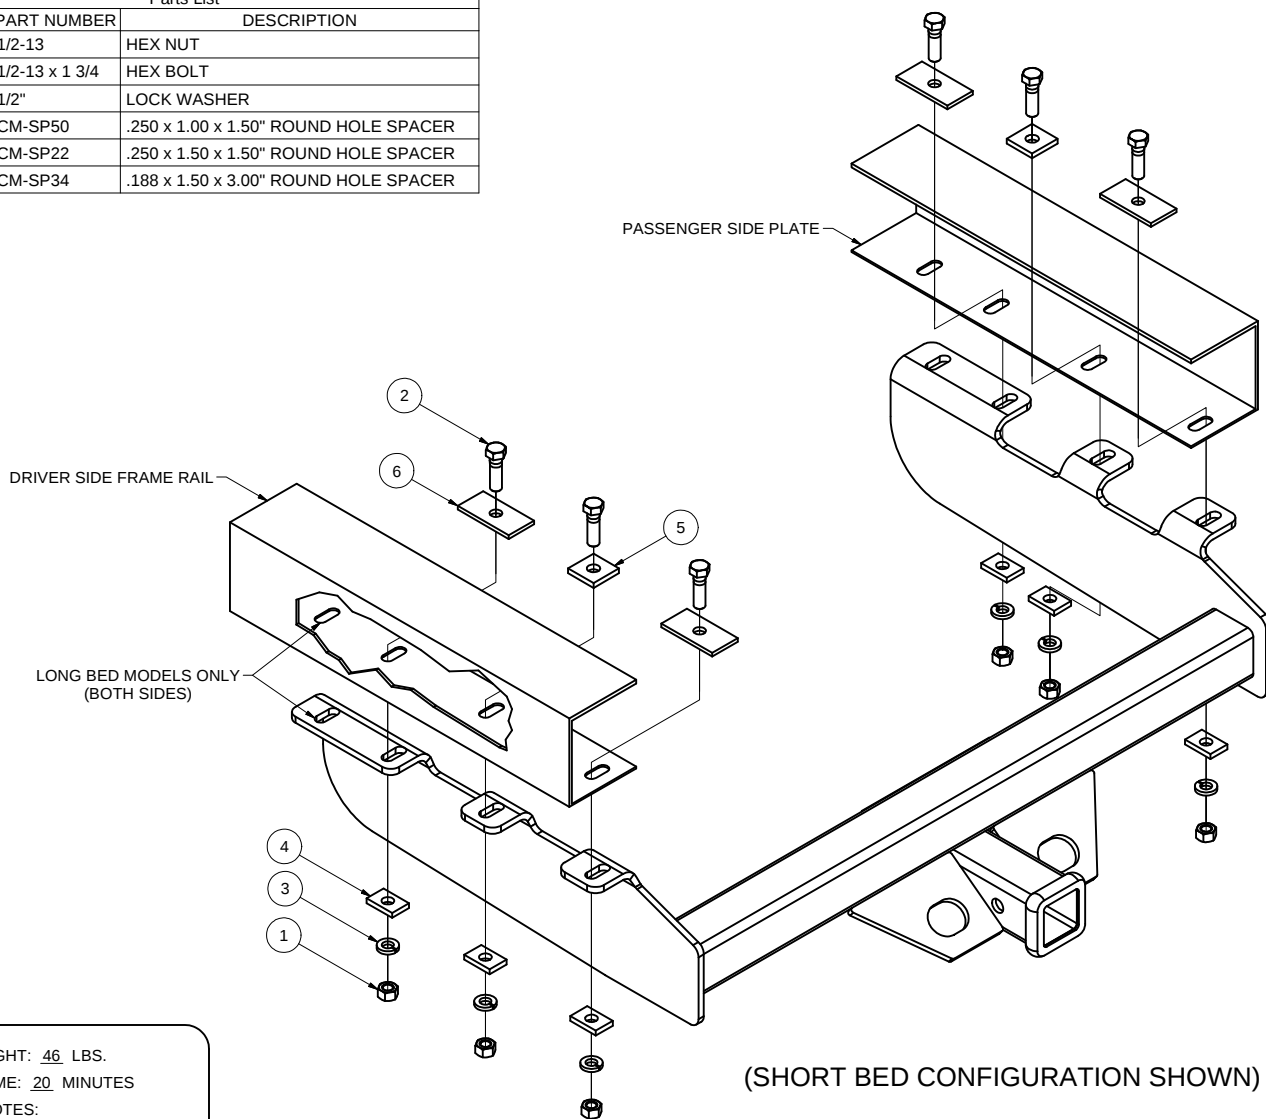
WILL NOT FIT SPORT WITH DUAL EXHAUST AND 2002 1500 SERIES

GROSS LOAD CAPACITY WHEN USED AS A WEIGHT CARRYING HITCH: 15,000 LBS. TRAILER WEIGHT & 1,500 LBS. TONGUE WEIGHT.
GROSS LOAD CAPACITY WHEN USED AS A WEIGHT DISTRIBUTION HITCH: 16,000 LBS. TRAILER WEIGHT & 1,600 LBS. TONGUE WEIGHT

*****DO NOT EXCEED VEHICLE MANUFACTURER'S RECOMMENDED TOWING CAPACITY.*****

HAVING INSTALLATION QUESTIONS? CALL TECHNICAL SUPPORT AT 1-800-798-0813

Parts List			
ITEM	QTY	PART NUMBER	DESCRIPTION
1	6	1/2-13	HEX NUT
2	6	1/2-13 x 1 3/4	HEX BOLT
3	6	1/2"	LOCK WASHER
4	6	CM-SP50	.250 x 1.00 x 1.50" ROUND HOLE SPACER
5	2	CM-SP22	.250 x 1.50 x 1.50" ROUND HOLE SPACER
6	4	CM-SP34	.188 x 1.50 x 3.00" ROUND HOLE SPACER

HITCH WEIGHT: 46 LBS.INSTALL TIME: 20 MINUTES

INSTALL NOTES:

- DRILLING / HOLE ENLARGEMENT
MAYBE REQUIRED.

(SHORT BED CONFIGURATION SHOWN)

INSTALLATION STEPS

1. Raise hitch into position. Align rear holes in side plates with 1 1/8" round holes in rear of frame. On long bed models, forward most holes will line up with holes 16" forward of rear holes in frame.
2. Install all 1/2" hardware as shown.
Note: CM-SP34 spacers are used for outside holes and CM-SP22 spacers are used for middle holes.
3. Torque all 1/2" hardware to 75 lb-ft.

**PERIODICALLY CHECK THIS RECEIVER HITCH TO ENSURE THAT ALL FASTENERS
ARE TIGHT AND THAT ALL STRUCTURAL COMPONENTS ARE SOUND.**

Curt Manufacturing Inc., warrants this product to be free of defects in material and/or workmanship at the time of retail purchase by the original purchaser. If the product is found to be defective, Curt Manufacturing Inc., may repair or replace the product, at their option, when the product is returned, prepaid, with proof of purchase. Alteration to, misuse of, or improper installation of this product voids the warranty. Curt Manufacturing Inc.'s liability is limited to repair or replacement of products found to be defective, and specifically excludes liability for incidental or consequential loss or damage.