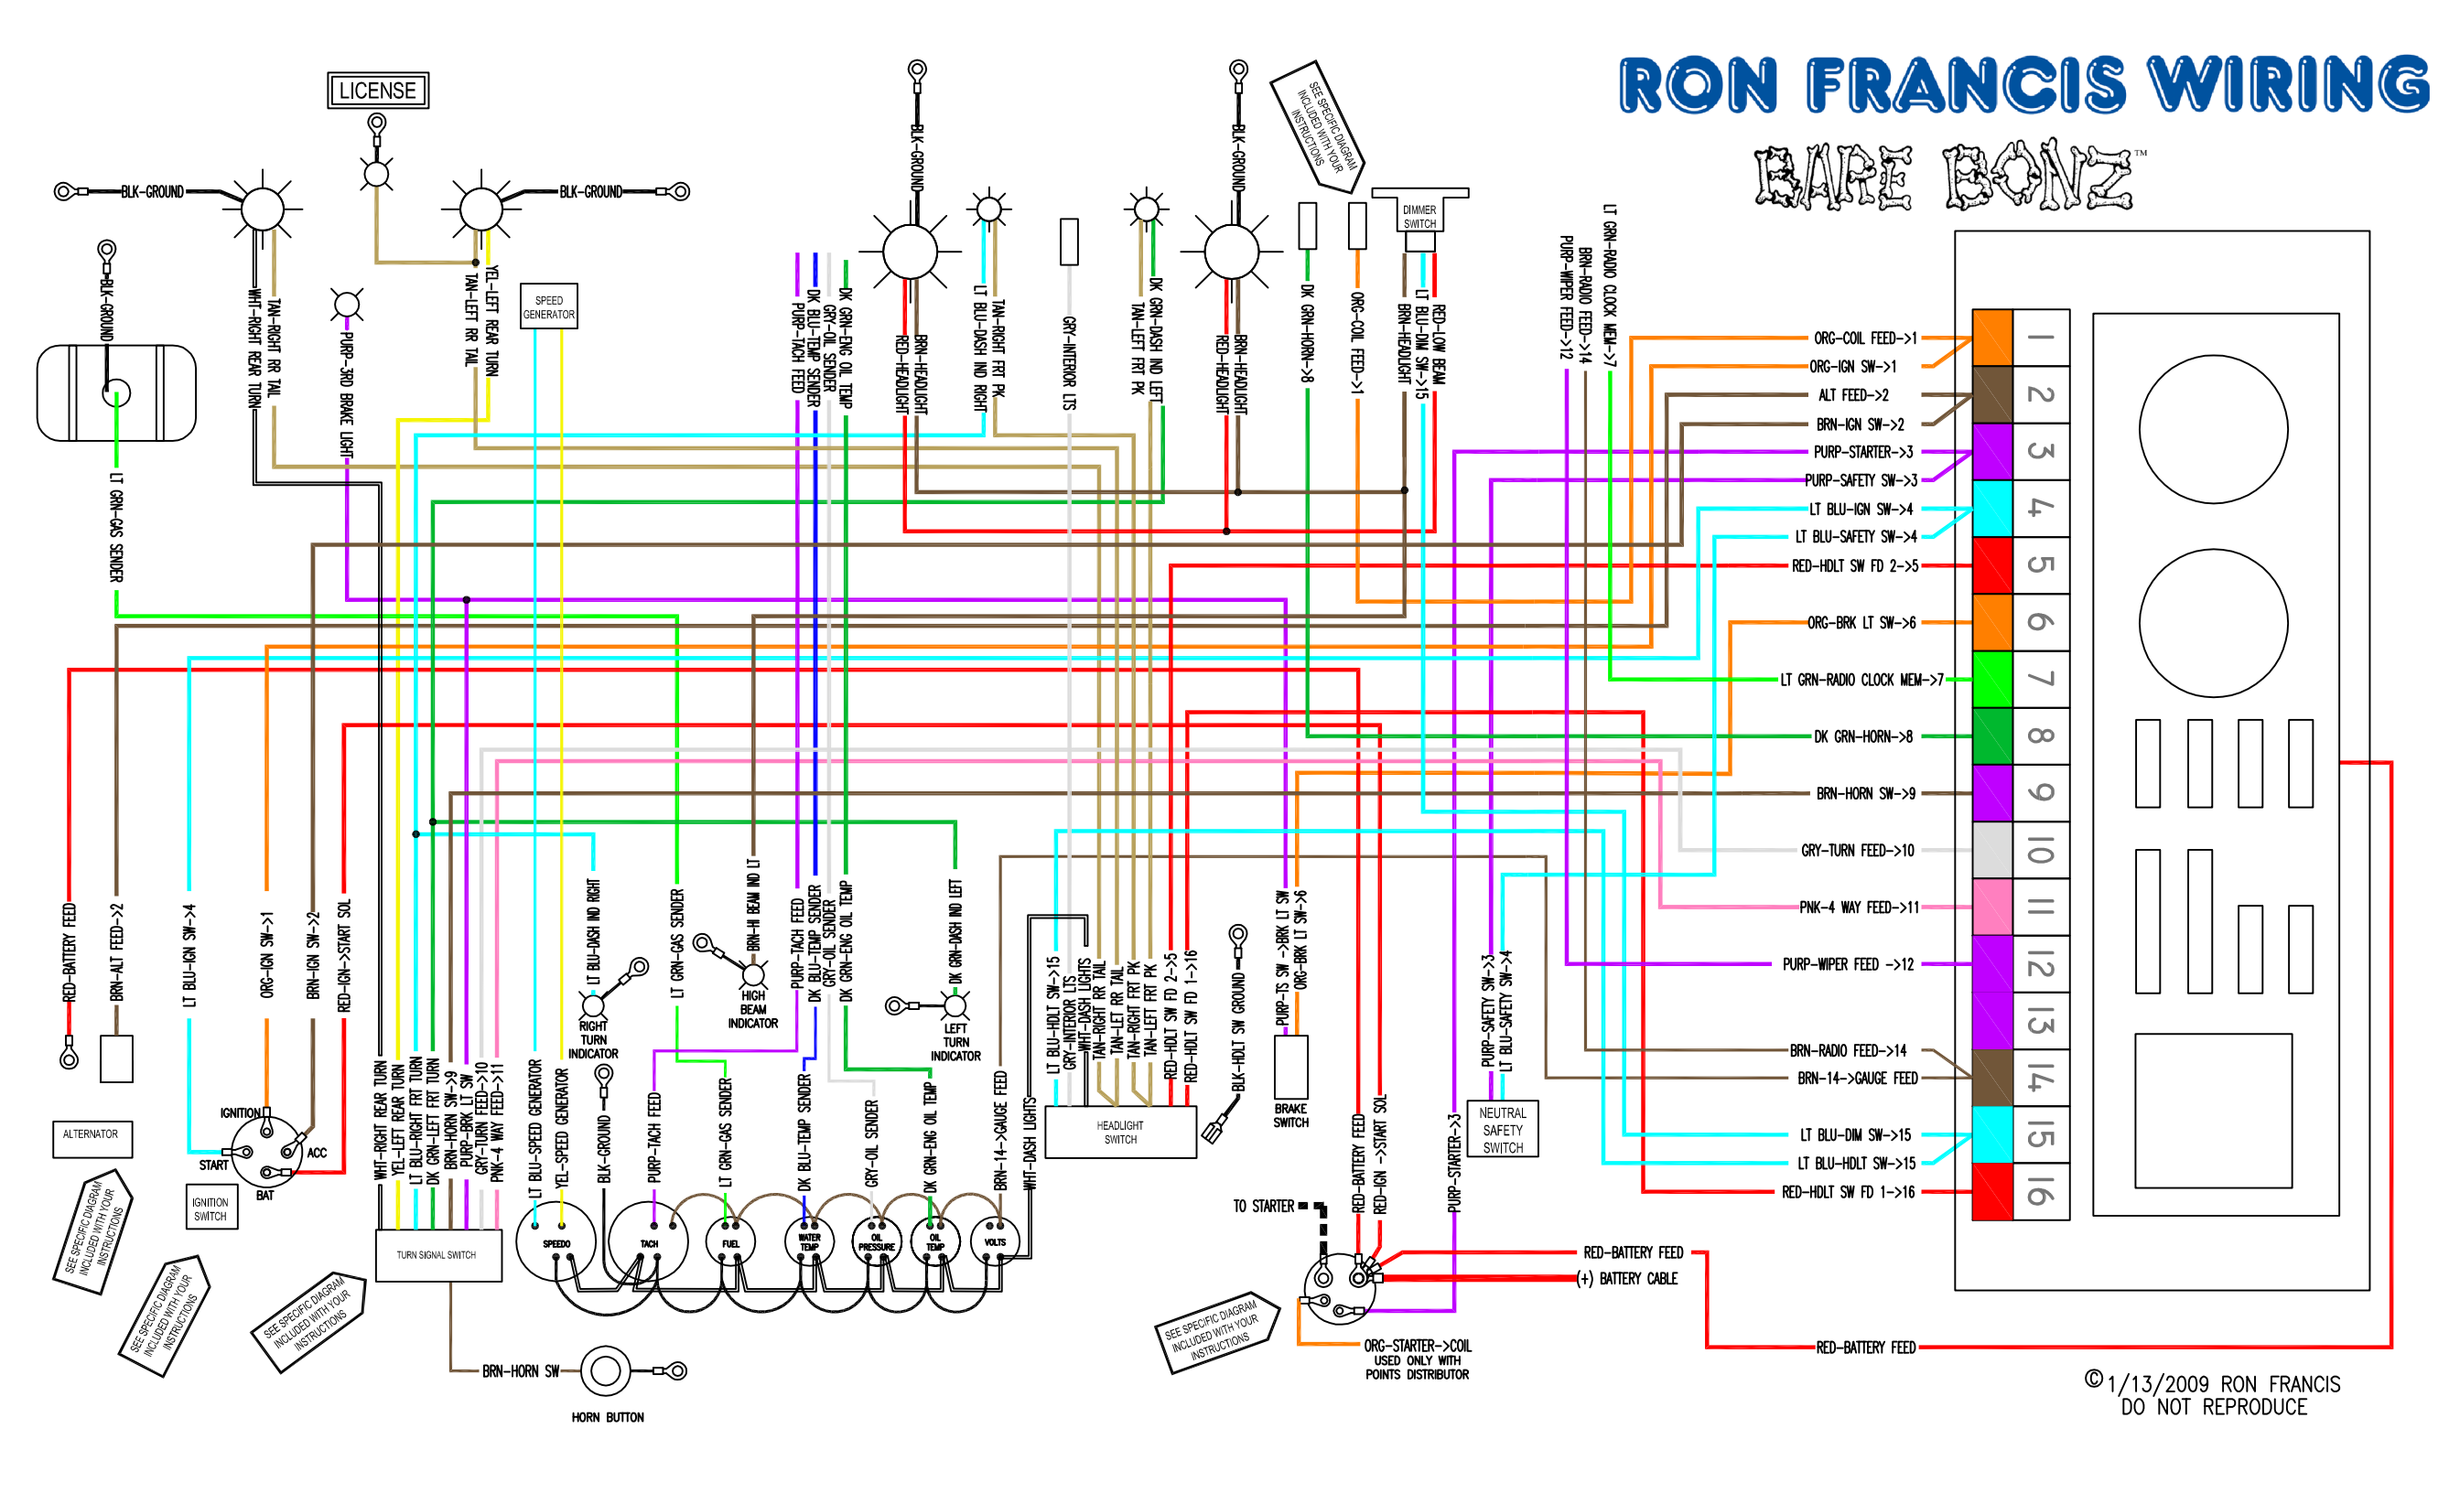
RON FRANCIS WIRING
BARE BONZ™
LICENSE
BLK-GROUND
SPEED GENERATOR
DIMMER SWITCH
SEE SPECIFIC DIAGRAM INCLUDED WITH YOUR INSTRUCTIONS
ORG-COIL FEED->1
ORG-IGN SW->1
ALT FEED->2
BRN-IGN SW->2
PURP-STARTER->3
PURP-SAFETY SW->3
LT BLU-IGN SW->4
LT BLU-SAFETY SW->4
RED-HDLT SW FD 2->5
ORG-BRK LT SW->6
LT GRN-RADIO CLOCK MEM->7
DK GRN-HORN->8
BRN-HORN SW->9
GRY-TURN FEED->10
PNK-4 WAY FEED->11
PURP-WIPER FEED ->12
BRN-RADIO FEED->14
BRN-14->GAUGE FEED
LT BLU-DIM SW->15
LT BLU-HDLT SW->15
RED-HDLT SW FD 1->16
1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16
ALTERNATOR
IGNITION SWITCH
IGNITION
START
BAT
ACC
TURN SIGNAL SWITCH
RIGHT TURN INDICATOR
HIGH BEAM INDICATOR
LEFT TURN INDICATOR
HEADLIGHT SWITCH
BRAKE SWITCH
NEUTRAL SAFETY SWITCH
SPEEDO
TACH
FUEL
WATER TEMP
OIL PRESSURE
OIL TEMP
VOLTS
TO STARTER
RED-BATTERY FEED
(+) BATTERY CABLE
ORG-STARTER->COIL USED ONLY WITH POINTS DISTRIBUTOR
BRN-HORN SW
HORN BUTTON
©1/13/2009 RON FRANCIS
DO NOT REPRODUCE