

15513**2001-CURRENT CHEVROLET/GMC 2500HD AND 3500HD, LONG BED, FULL SIZE PICKUP
WITH 10" STEP BUMPER, NOT INCLUDING 34" FRAME****8/5/2009**

GROSS LOAD CAPACITY WHEN USED AS A WEIGHT CARRYING HITCH: 15,000 LBS. TRAILER WEIGHT & 1,500 LBS. TONGUE WEIGHT.
GROSS LOAD CAPACITY WHEN USED AS A WEIGHT DISTRIBUTION HITCH: 16,000 LBS. TRAILER WEIGHT & 1,600 LBS. TONGUE WEIGHT

*****DO NOT EXCEED VEHICLE MANUFACTURER'S RECOMMENDED TOWING CAPACITY.*****

Parts List			
ITEM	QTY	PART NUMBER	DESCRIPTION
1	6	1/2-13 x 1 3/4	CARRIAGE BOLT
2	2	CM-SP19	.250 x 1.25 x 3.00" SQUARE HOLE SPACER
3	4	CM-SP3	.250 x 1.25 x 2.00" SQUARE HOLE SPACER
4	6	HFN 1213	HEX FLANGE NUT

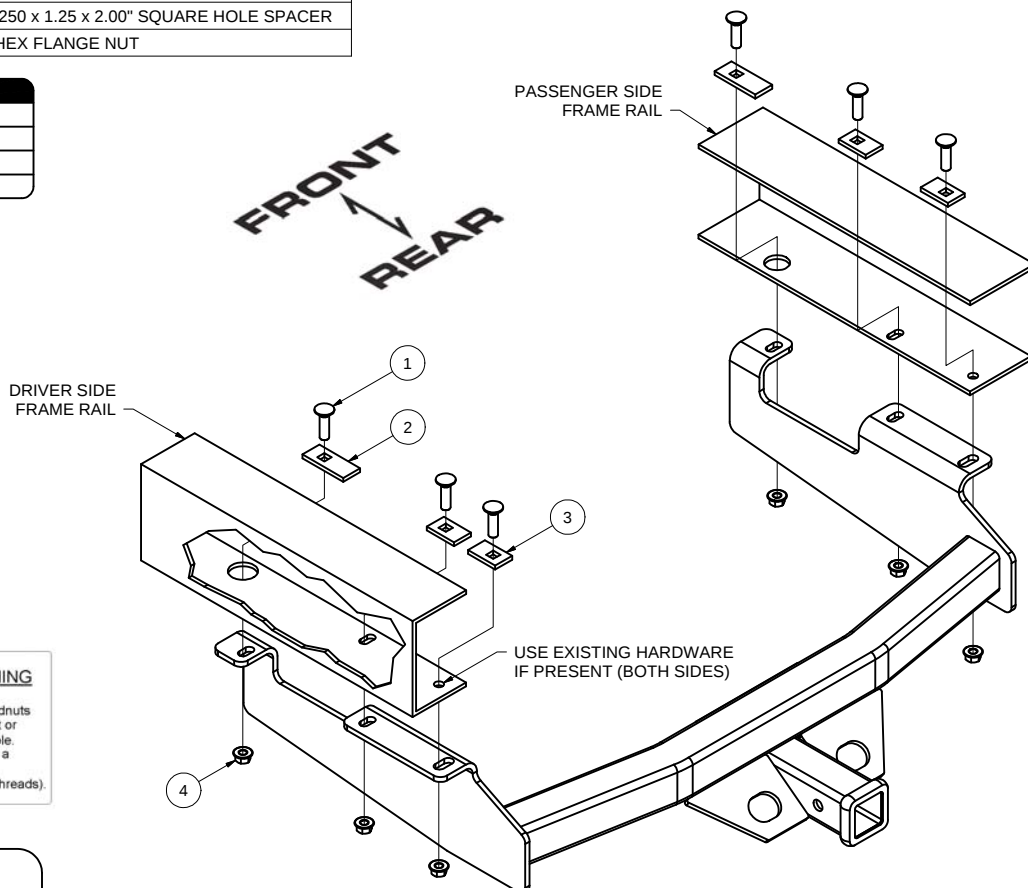
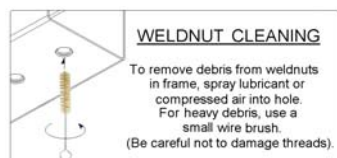
TOOLS REQUIRED

SOCKET WRENCH

TORQUE WRENCH

3/4" SOCKET

SOCKET EXTENSION

HITCH WEIGHT: 56 LBS.

INSTALL TIME:

PROFESSIONAL: 30 MINUTESNOVICE (DIY): 60 MINUTES

INSTALL NOTES:

- SPARE TIRE REMOVAL
- NO DRILLING REQUIRED

INSTALLATION STEPS

1. Remove spare tire for ease of installation.
2. Raise hitch and align with existing holes in frame rails.
3. Install 1/2-13 carriage bolts, CM-SP19 spacers in forwardmost holes. Install 1/2-13 carriage bolts and CM-SP3 spacer in remaining holes. Install 1/2-13 hex flange nuts onto carriage bolts as shown.
Note: If existing hardware and weldnuts are present in the rearmost holes, use the existing hardware in place of the 1/2" hardware in this kit.
4. Torque all 1/2" hardware to 75 lb-ft.
5. Reinstall spare tire.

**PERIODICALLY CHECK THIS RECEIVER HITCH TO ENSURE THAT ALL FASTENERS
ARE TIGHT AND THAT ALL STRUCTURAL COMPONENTS ARE SOUND.**

Curt Manufacturing Inc., warrants this product to be free of defects in material and/or workmanship at the time of retail purchase by the original purchaser. If the product is found to be defective, Curt Manufacturing Inc., may repair or replace the product, at their option, when the product is returned, prepaid, with proof of purchase. Alteration to, misuse of, or improper installation of this product voids the warranty. Curt Manufacturing Inc.'s liability is limited to repair or replacement of products found to be defective, and specifically excludes liability for incidental or consequential loss or damage.